





# ASSEMBLY INSTRUCTION

## BNC | 75Ω Cable Jack Panel version


**A**

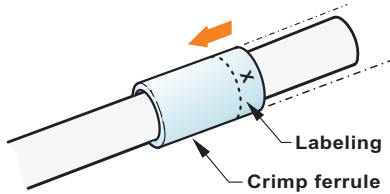



**B**

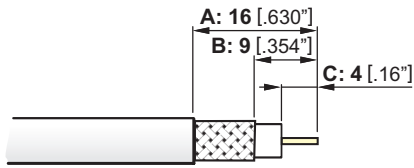

**C**

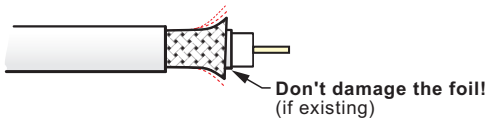


**D**

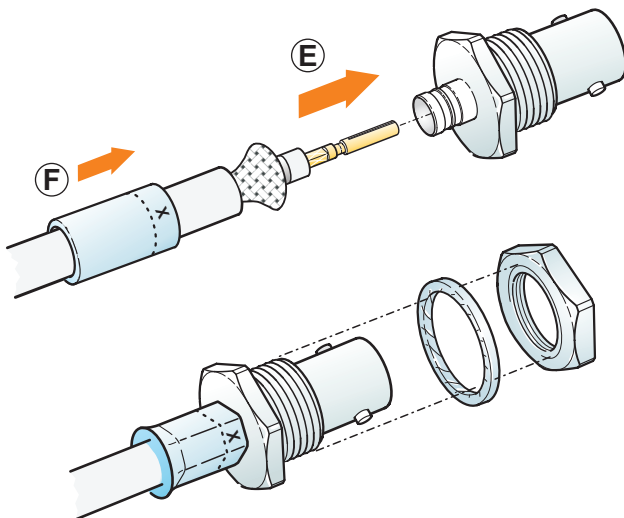 

**A** Slide the crimp ferrule onto the cable

**B** Prepare cable as shown  
- Use an adjustable coaxial cable stripper

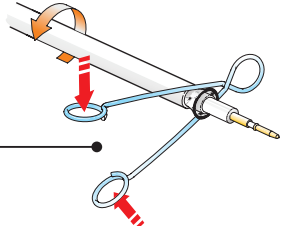
**C** Spread the braided shield  
(It's easily with the Neutrik "SHIELD-SPREADING-TOOL"!) 

**D** Crimp the pin  
- position the pin on the center conductor  
- Crimp the pin with the tool  
(For best crimping-results it is recommended to use the original Neutrik crimp tool  
- HXBNC with the corresponding insert  
or hexcrimp acc. to IEC 803-W (SW 1.7)  
or squarecrimp acc. to IEC 803-2 (SW 1.6)  
- Pin can also be soldered (Optional)!  
- Straighten the pin if misaligned.

**E** Insert the cable into the connector body

**F** Slide the crimp ferrule over the shield to the front and push the cable and leading ferrule to it's end position until you hear a snap noise.

**G** Crimp the ferrule with the tool  
(For best crimping-results it is recommended to use the original Neutrik tool - HXBNC with the corresponding insert)

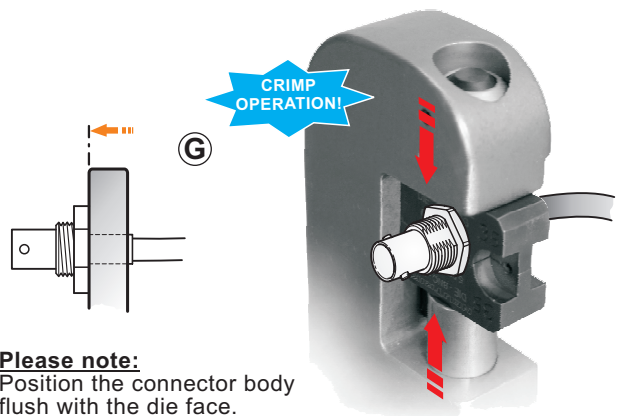

**Please note:**  
Position the connector body flush with the die face.

NEUTRIK AG LI T: +423 / 237 24 24 F: +423 / 232 53 93  
NEUTRIK Zürich AG CH T: +41 44 / 736 5010 F: +41 44 / 736 5011  
NEUTRIK USA Inc. USA T: +1 732 / 901 9488 F: +1 732 / 901 9608  
NEUTRIK (UK) Ltd. UK T: +44 1983 / 811 441 F: +44 1983 / 811 439

NEUTRIK Vertriebs GmbH DE/NL/AT T: +49 8131 / 280 890 F: +49 8131 / 280 830  
NEUTRIK France FR T: +33 1 / 4131 6750 F: +33 1 / 4131 0511  
NEUTRIK Tokyo Ltd. JP T: +81 3 / 3663 4733 F: +81 3 / 3663 4796  
NEUTRIK Hong Kong Ltd. HK T: +852 / 2687 6055 F: +852 / 2687 6052

Draft. Nr.: BDA 120 / 3102M1201 | Update: 09.04.2008 | Data subject to change without prior notice. ©2008NEUTRIK®. ALL RIGHTS RESERVED.

[www.neutrik.com](http://www.neutrik.com)

**NEUTRIK**